



## Check-out scale Indicator

# PDI Series



## Check-out scale Indicator

- Suitable to use in narrow place as simple indicator
- Connectable with various ECR & POS system
- Offering suitable solution to various shop such as supermarket and general store etc



Connectable with various ECR system



Easy to controll



Adjustable view angle of indicator



## ■ Features

### 1. Adjustable view angle of indicator (For Pole type)

The user can view weight in various angle with adjustment of view angle of indicator




### 2. 2 types of Indicator : Pole type(PDI) / Desktop type(PDI-D)



### 3. Connectable with various platform

Connectable with various ECR system, POS system and check out scale

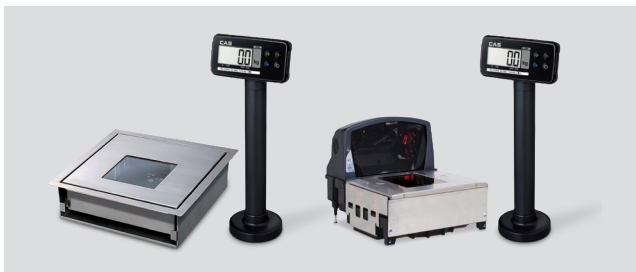

### 4. Easy operations

### 5. Simple and prompt full digital calibration

(automatic weight setup at once)

### 6. Weight backup functions

(restoring weight at the power supply On/Off)

### 7. Multiple weights setup functions (5 point input weight setup)

### 8. Command Mode (ECR Protocol)

### 9. 6 wired (basic)/4 wired load cell Input

## ■ Options

- USB Interface

## ■ Specifications

Model	PDI / PDI-D	
Type	Pole type / Desktop type	
Applied voltage for load cell	DC 5V(350Ω maximum 8 possible connections)	
Zeroing range	0~2 mV/V	
Input sensitivity	0.5 uV/D (OIML, )Ntep, KS	
	0.5 uV/D (Non OIML, )Ntep, KS	
A/D internal resolution	1/520,000	
A/D external resolution	1/10,000 (NTEP, )OIML, KS	
	1/20,000 (Non NTEP, )OIML, KS (Possible with the use of sufficient output at 2mV/V L/C)	
A/D conversion speed	80times/sec	
Sign for status	STABLE, NET, ZERO, COM	
Weight display	LCD(6 digit + Sign)	
AC Adapter	AC 100~240 V(DC 12V, 1.25A)	
Operating temperature	-10°C ~ 40°C	
Product size(mm)	141(W) X 101(D) X 382(H) / 141(W) x 69(D) x 86(H)	
Product weight	500g	
Product weight	Standard	COM1(RS-232 Printer & PC Interface)
	Option	USB

## ■ Dimensions

